




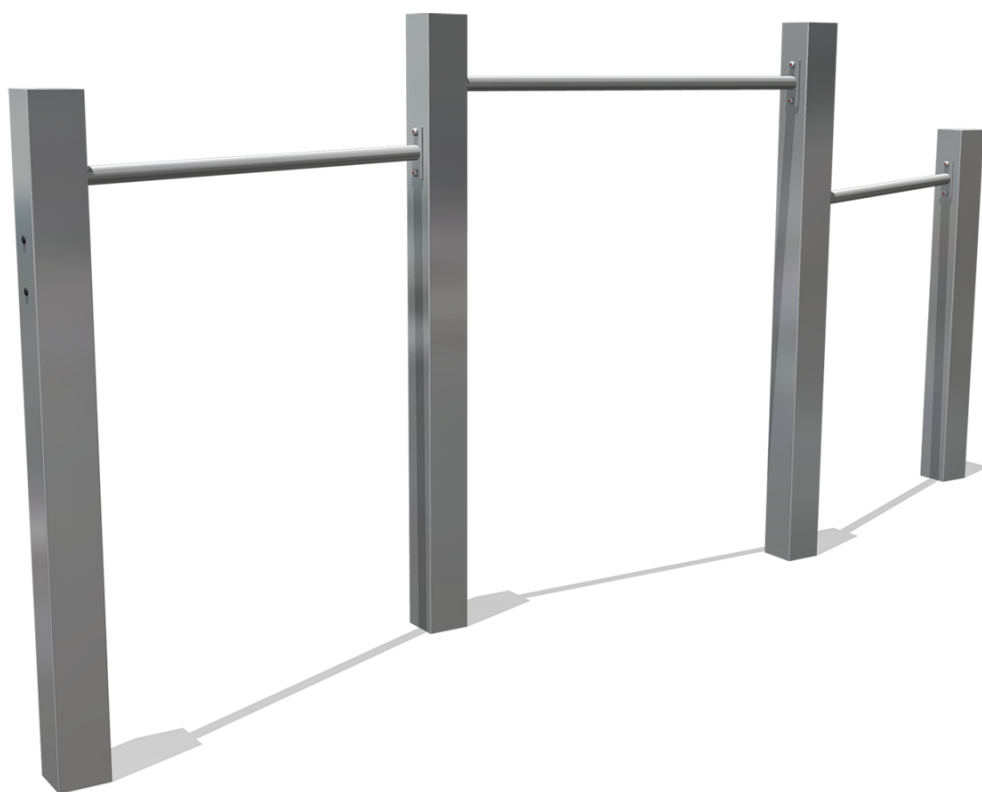




Triple tumble bar

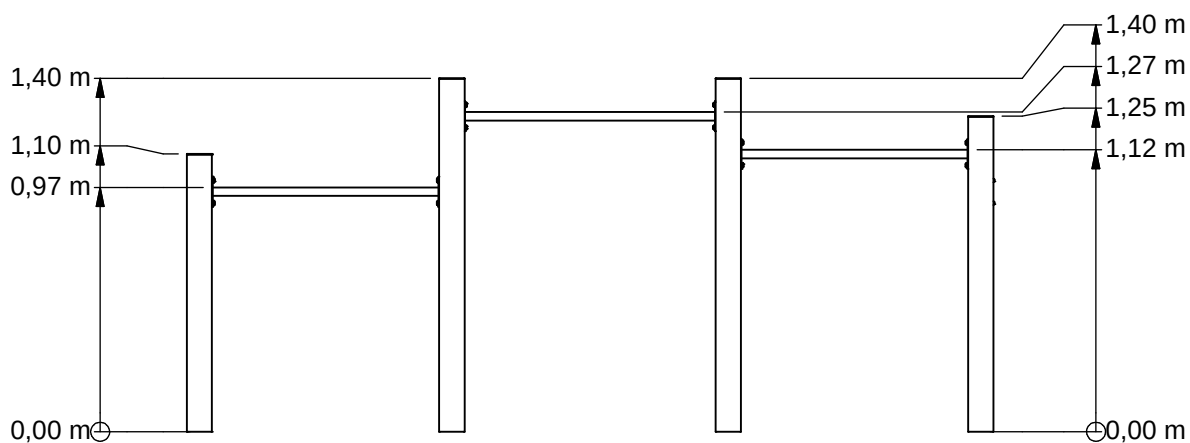

SOLE030.072

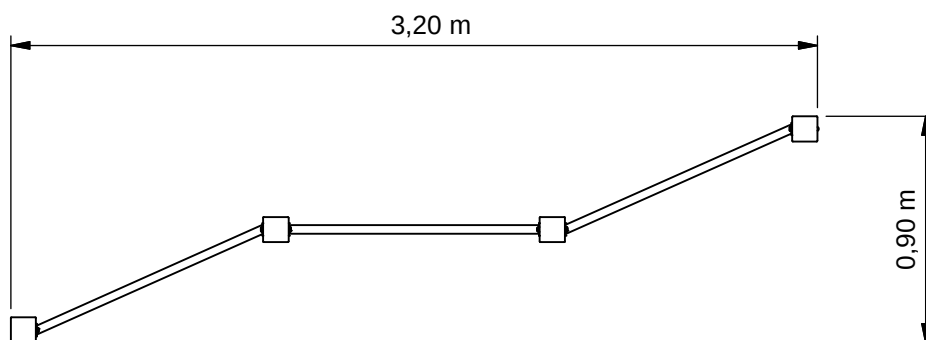

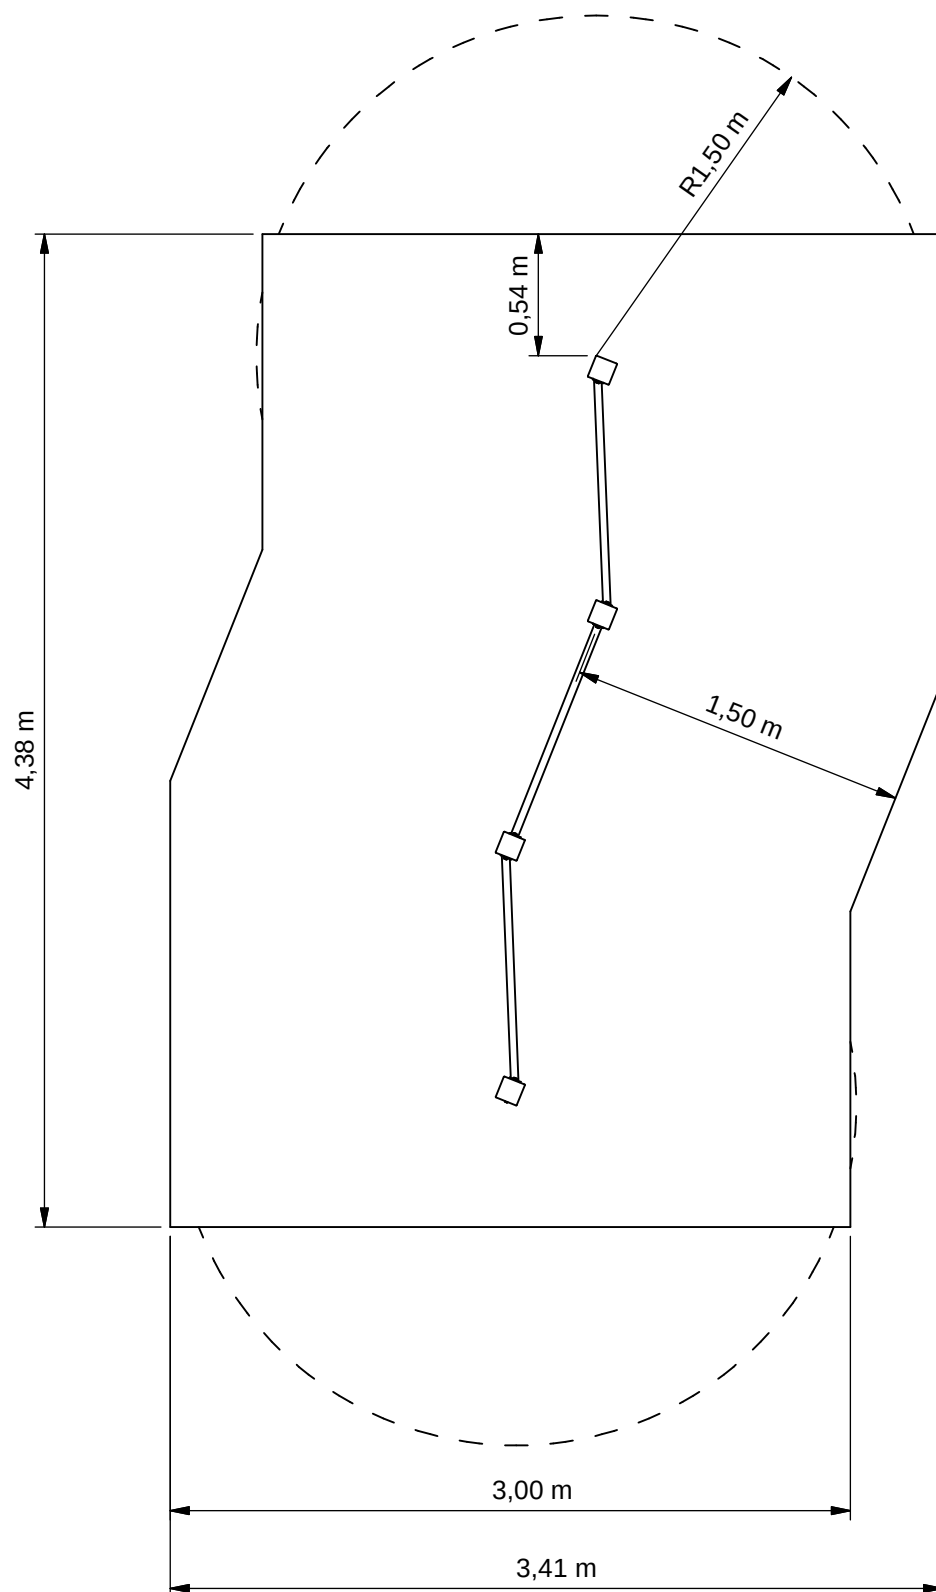

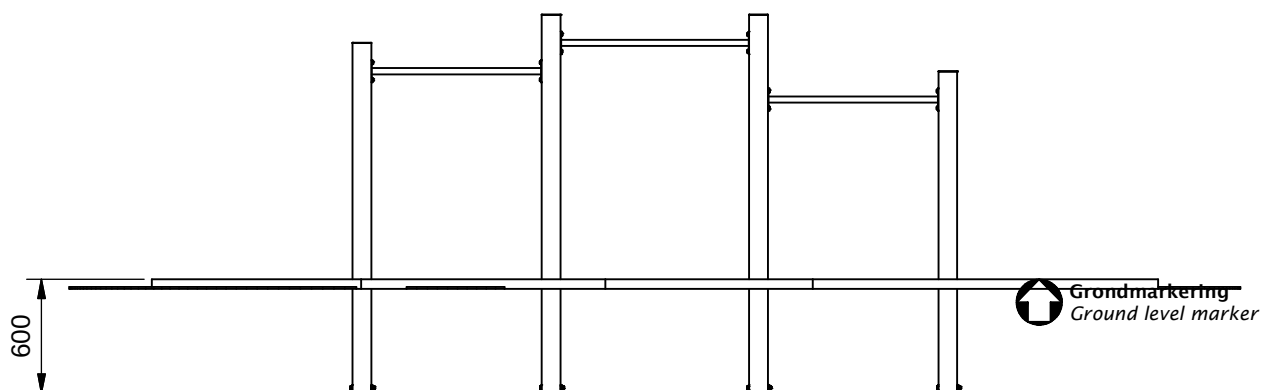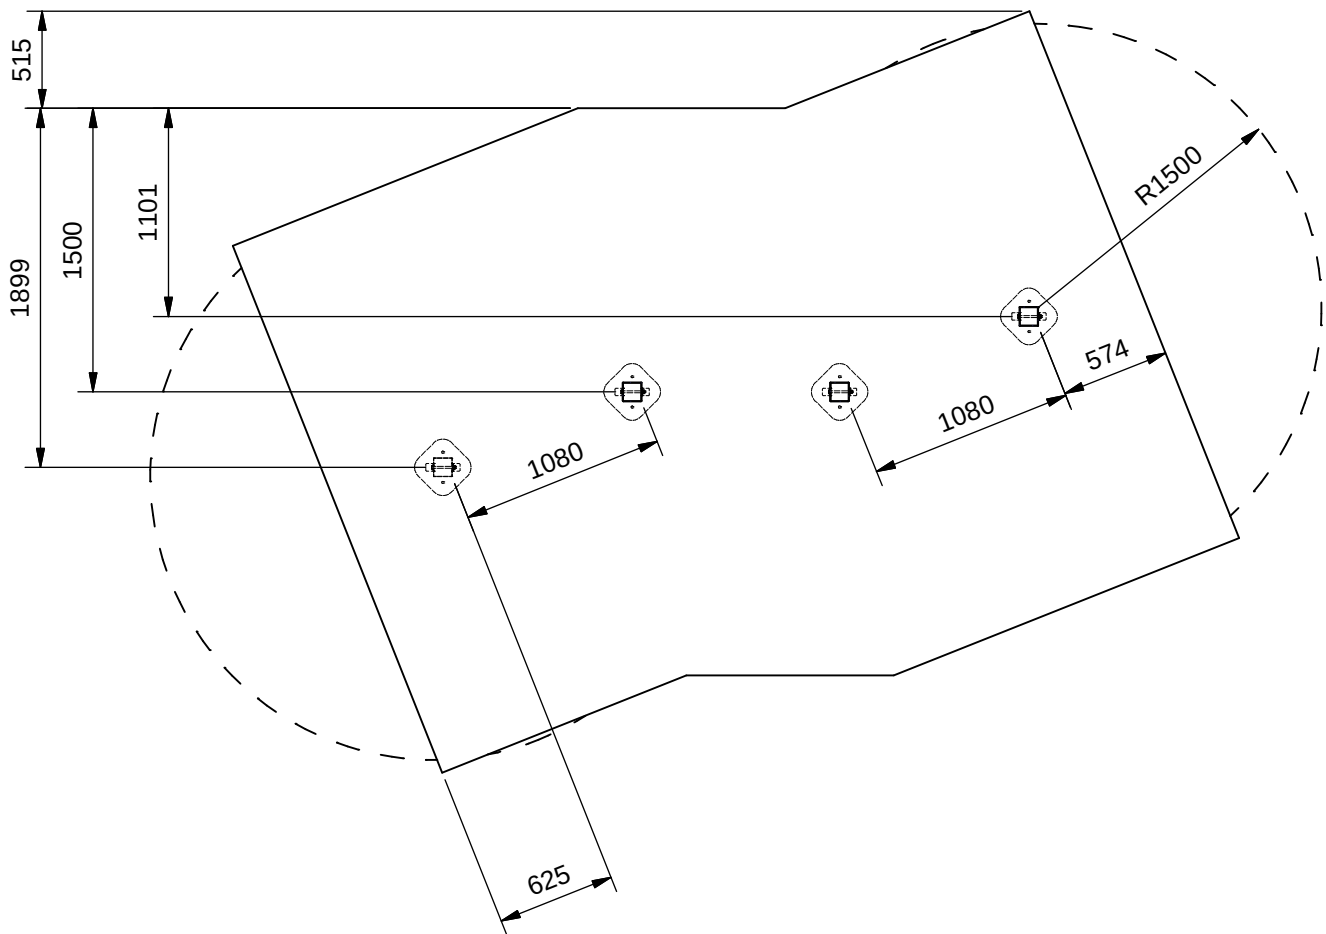

Geleverde modules:

Zie tabel

Supplied modules:

See table

Montageinstructie:

- De hoofdmaten geven de maten van de staanders en vloeren aan
- De detailtekeningen geven specifiek de maten van de verbindingen aan
- De modules met buizen zijn op de tekeningen bemaat op bovenkant kopplaat
- Overige modules zijn bemaat op de bovenkant (klimwanden, paalkappen, etc.)

Assembly instruction:

- The main dimensions indicate the dimensions of the posts and floors
- The detailed dimensions show the specific dimensions of the connections
- The modules which contain tubes are dimensioned at the top of the flanges
- Other modules are dimensioned at the top (climbing walls, caps for the posts, etc.)

Montagevolgorde:

- 1 - Graaf de gaten volgens het bodemplan
- 2 - Plaats 1
- 3 - Controleer of het toestel voldoet aan de afmetingen zoals op blad 'afmetingen'
- 4 - Dicht de gaten en verdicht het zand

Assembly sequence:


- 1 - Dig the holes according to the ground plan
- 2 - Place 1
- 3 - Check that the equipment conforms to the dimensions shown on sheet 'dimensions'
- 4 - Close the holes and compact the sand

Controles:

- 1 - Correcte opbouw en alle bevestigingsmiddelen
- 2 - Controleer de afmetingen van de valbodem t.o.v. het toestel

Checks:

- 1 - Correct assembly and all the fasteners
- 2 - Check the dimensions of the safety area with regard to the play equipment

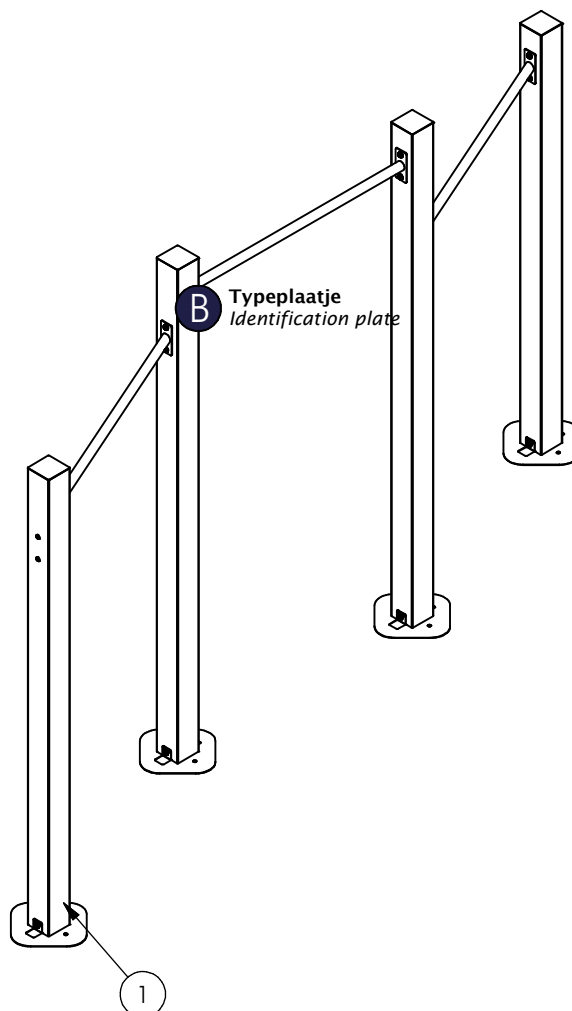

Nr	#	Type	Progr.	Volgnr	Bew.	Rev.	Benaming	Opmerking
1	1	MOD	SOL	030	395	A	DUIKEL RVS	TRIO



Benaming
Title Duikel RVS

Opmerking
Comment Trio

Datum
Date 17-1-2017

Tekening
Drawing

TOE SOL 030 072 A

Modules Modules

SOLE030.072

Triple tumble bar

LOGBOOK

(Onderstaand logboek kan gebruikt worden om te voldoen aan de eisen, gesteld in artikel 14 van het Warenwetbesluit Attractie- en Speeltoestellen)

Type indication	Nature Play
Product code	SOLE030.072
Name of equipment	Duikel Trio RVS
Maximum height of fall	1,3 m
Year of construction	2017
Certificate	09200116206
inspection authority	Liftinstituut B.V. Buikslotermeerplein 381, A'dam - 1025 XE Amsterdam
Name manufacturer	BOERplay Hyacintstraat 2 - 4255 HX Nieuwendijk Phone: +31 (0)183 40 23 66 Fax: +31 (0)183 40 35 64
name installer	
Description of equipment	Triple tumble bar
Location of equipment	
Data about the owner of the play equipment	
Name:	
Address:	
Postcode and town:	
Contact person:	
Telephone number:	
Data about the administrator of the play equipment	
Name:	
Address:	
Postcode and town:	
Contact person:	
Telephone number:	

LOGBOOK

Inspection and maintenance intervals



Nr.	Inspection	Maintenance	months between inspections
1	Verify equipment's stability, junctions and missing parts. Inspect bolts, screws and nuts for absence, jams, corrosion and wear.	Add missing parts, secure joints, apply missing fixing agent and replace corroded parts.	1
2	Check suspension for wear.	Replace worn parts and/or remove non-functioning parts.	1
3	Inspect rotating parts such as hinges, rolling-element bearings, etc. for wear and acceptability.	Replace worn parts and/or remove non-functioning parts.	1
4	Check wood for splinters, unacceptable damage and signs of rot. Especially at ground level.	Repair damage. Replace affected wood. Smoothen splintered wood and sharp edges.	1
5	Inspect foundation for stability, tearing and coverage.	Restore foundation and covering material.	3
6	Examine rubber and synthetic parts for wear, damage and break.	Replace original parts.	3
7	Inspect metal for corrosion and damage in the coating.	Restore any damaged coating (after removing rust and applying primer).	6
8	Check ropes, cables, chains and nets for wear and damage. Steel cables and nets which are tensioned must be checked for tension.	Replace parts where necessary. Steel cables and nets must be tensioned.	3
9	Inspect equipment for unsafe changes and additions.	Remove unsafe additions and correct unsafe changes.	1
10	Inspect safety surfaces.	Restore and repair where necessary.	1

Remarks

1. If used intensively, all points require extra attention.
2. Extreme weather conditions and locations may require a higher inspection frequency. Discuss this with the supplier.
3. Vandalism-sensitive locations require stricter inspections, possibly daily.
4. Check the terrain regularly for items that do not belong there, are unsafe or may be used wrongly. Examples are poisonous plants, glass shards, etc. Frequency depends on strain.
5. Remember that bad maintenance leads to unsafe conditions and notably faster impoverishment of the playground area.
6. Replacement parts can be ordered at the manufacturer with the part numbers on the module drawing. Drawings can be found in the user guide.
7. The impact area shall be provided with impact attenuating surface according to the specified falling height.
8. This list is conform the CEN-standard "playground equipment and surfacing NEN-EN 1176-7".

TYPE-EXAMINATION CERTIFICATE

Acting under the " Warenwetbesluit Attractie- en Speeltoestellen" issued by Liftinstituut B.V.
commissioned by departmental order, no. VGP/PSL 2857566 from 27 Juni 2008.

Certificate nr. : NL 09-200116206 Revision nr.: 1

Description of the product : Duikel, playground equipment in hardwood or INOX

Trademark, type : Boer Speeltoestellen
TOE SOL 030 011, 030 013, 030 014, 030 015, 030 020, 030 021, 030 023, 030 027, 030 040, 030 070, 030 070, 030 071, 030 072, 030 075, 030 076, 030 077, 030 078, 030 080, 030 083, 030 087, 030 088

Name and address of the manufacturer : Boer Speeltoestellen
Hyacinthstraat 2
4255 HX Nieuwendijk

Name and address of the certificate holder : Boer Speeltoestellen
Hyacinthstraat 2
4255 HX Nieuwendijk

Certificate issued on the basis of the following requirements : Warenwetbesluit Attractie- en Speeltoestellen, NEN-EN 1176-1:2008

Test laboratory : None

Date and number of the laboratory report : None


Date of type-examination : 2 March 2009

Annexes with this certificate : Report belonging to the type-examination certificate nr.: 200116206

Additional remarks : None

Conclusion : The playground equipment meets the requirements of the above specified European standard(s) and "Warenwetbesluit Attractie- en Speeltoestellen" taking into account any additional remarks mentioned above.


Issued in Amsterdam
Date of issue : 7 April 2009

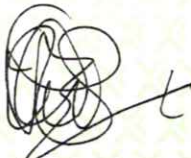

Ir. V.M.A. Barendregt
LIFTINSTITUUT B.V.
Senior Officer Certification
& Technology



Drs. B. Mulder
LIFTINSTITUUT B.V.
Director Certification &
Inspection International

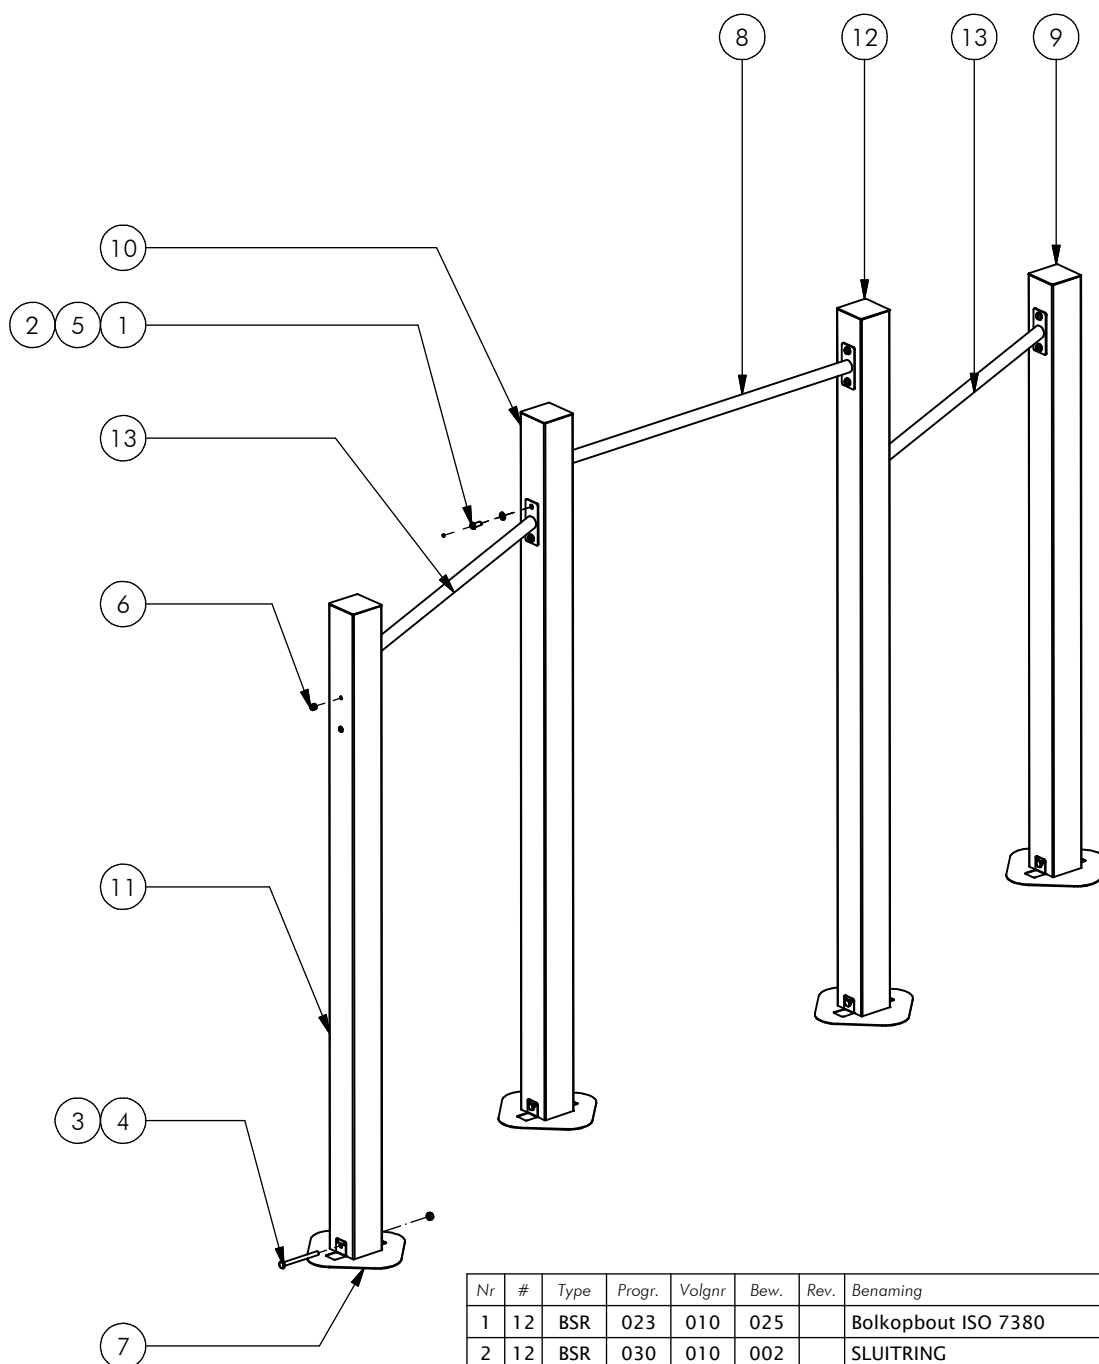

Nr	#	Type	Progr.	Volgnr	Bew.	Rev.	Benaming	Opmerking
1	12	BSR	023	010	025		Bolkopbout ISO 7380	M10 x 25 - RVS A2-70
2	12	BSR	030	010	002		SLUITRING	M10
3	4	BSV	010	010	010		Borgmoer	M10 - VZ 8.8
4	4	BSV	021	010	120		Zeskantbout ISO 4014	M10 x 120 - VZ 8.8
5	12	KST	DOP	006	030		OPVULDOPJE	6 MM ROOD
6	2	KST	LAM	015	005		LAMELLENSTOP	ROND 15
7	4	OME	VRB	903	VZP	B	Voetplaat	100 x 100
8	1	SME	SOL	041	320	B	DUIKELBUIS	1 M RECHT
9	1	SME	SOL	056	320	D	STAANDER DUIKEL	RVS 1.7 M
10	1	SME	SOL	075	320	C	STAANDER RVS	2.0 M
11	1	SME	SOL	089	320	C	STAANDER RVS	1.85 M DUIKEL
12	1	SME	SOL	090	320	C	STAANDER RVS	2.00 M DUIKEL LINKS
13	2	SME	SOL	095	320	A	BUIS DUIKEL	SCHUIN